



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D350-636-024
Job Sheet 188941



Part No: D350-636-024

Job Qty: 1 ea

Part Name: AS350/355 - Skidtubes - Standard w/ Heavy-Duty Wearplates - RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 1/16/19

Job Tracking No:

Due Date: 2/15/19

Created By: Jesse White

Type: Stock

Description:

Note: D4168-052 REV.C, IIN-D350-636 REV.K IPP REV.A 18.11.29 NEW ISSUE DD VERF:JFS

Ship Via:

Bill of Materials

FGW

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date: _____ Sequence #: _____		QTY Affected : _____		MRB (QS1042)	
Dart Aerospace Ltd. 127th Aberdeen Street Haverhill, ON K1A 1K7 CANADA TEL: 613 592-5200 Email: sales@dart aero.com www.dartaerospace.com Part: D350-636-024 Container No: S146366 Job No: 188941 Serial No/Batch: S146366 Revision: C/K Inspector: _____ Exp Date: _____ Instructions: _____ Date: 01/22/19				Disposition	
				Completed By _____	
				Lead hand / Supervisor _____	
				QC / QA Coordinator _____	
FAULT CATEGORY					
Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Other/Details: _____ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread ☐			

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		2/15/19	0.00	0.00	Start Up Skid tubes-1		BE
110	Skid tubes	1 pcs		2/15/19	0.00	4.78	Skid tubes-1		BE
120	QC	1 pcs		2/15/19	0.00	0.00	QC10		38 DAS
130	QC	1 pcs		2/15/19	0.00	0.00	QC5		9-89 38
140	HandFinish	1 pcs		2/15/19	0.00	0.98	HandFinish1		D.R. 19/01/28
150	QC	1 pcs		2/15/19	0.00	0.00	QC7-2		BE
160	Skid tubes	1 pcs		2/15/19	0.00	4.78	Skid tubes-1		BE, TF
170	QC	1 pcs		2/15/19	0.00	0.00	QC10		PD 19-03-01
180	QC	1 pcs		2/15/19	0.00	0.00	QC5		PD 19-03-01
190	HandFinish	1 pcs		2/15/19	0.00	0.98	HandFinish2		D.R. 19/03/04
200	SprayPaint	1 pcs		2/15/19	0.00	0.61	Spray Paint		AR 19-3-5
205	Outsource	1 pcs		2/15/19			ATE003-VC	5	NR
210	QC	1 pcs		2/15/19	0.00	0.00	QC14		11 19-3-25
230	HandFinish	1 pcs		2/15/19	0.00	0.98	HandFinish4		11 19-5 DAS
240	QC	1 pcs		2/15/19	0.00	0.00	QC5		MAY 9 3 2019 68
250	Packaging	1 pcs		2/15/19	0.00	0.00	Packaging1-3		DAS 46 MAY 9 2019
260	QC	1 pcs		2/15/19	0.00	0.00	QC4		DAS 46 MAY 9 2019
270	Packaging	1 pcs		2/15/19	0.00	0.00	Packaging3-1		21 9-89 4 MAY 9 2019
275	DC	1 pcs		2/15/19	0.00	0.00	DC		9-89 MAY 9 2019
280	QC21-FG	1 Ea		2/15/19	0.00	0.00	QC21		DAS 21 MAY 9 2019

Part Op 110 - 1- Pick D2600-3 Bent 2- Deburr FWD and AFT ends, remove bending marks. Scribe batch# inside AFT end per dwg
 Descriptions: D4168-6 3- Drill pilot holes for blade fitting bolt holes using DT8983. Start with 3/16", then open to 0.500" using center drill then ream holes using 0.500" reamer. PIN first side. Repeat process on second side. ***ENSURE PROPER POSITIONING FWD BEND MUST BE FACING UP WHEN DRILLING FIRST SIDE*** Drill pilot holes as per Dwg D4168 (D4168-6 details). Drill using drill Jig DT8150 & DT8863A for first side only DT8863B for second side 4- Locate DT8329 off of blade fitting bolt holes and drill pilot holes for blade fitting, section DK-DK and open to 0.500" 5- Drill tow ring hole using DT9616 detail "DF" 6- Drill most FWD wearplate hole using DT9678 locating of 66.54" hole 7- Open up holes of Detail DF to 0.297" (total of 2 holes per side) +.201" (total of one hole per side DT9616) as per dwg D4168. 8- Weld D2744 Cap as per Dwg D4168 and QSI 004. Fill grooves in bend left from bending as per QSI 004 A/R Aluminum Rod batch:

138969 9- Grind welds flush as per Dwg D4168

160 - 1-Open up holes using hole saw of Detail DG and ground handling to 0.625" (total of 8 holes per side) as per dwg D4168. 4-Chamfer holes of Detail DG, ground handling and float holes per dwg D4168 (welding instructions on sheet) 5- Deburr and blow out all chips from inside of tube 6- Prepare tube for welding, remove alodine as required. 7-Bond web D2739 in place as per QSI 015, let cure for 12hrs. A/R Sikaflex-291 batch: M138984 exp. date: 03/07/19 ***ATTN: USE I-BEAM LOCATION AID (BLADE FITTING)*** 8- Weld spacers D2743 as per dwg D4168 & QSI004 (welding instructions on sheet) A/R Aluminum Rod batch: 138984 10-Grind welds flush as per Dwg D4168 11-Spot face ground handling holes section ES-ES (total of 4 places per side) as per dwg D4168 12- C'bore section ET-ET. ADJUST TOOLING AS REQUIRED. VERF BY: 13- Deburr holes, ensure tube is free of all scratches before sending to paint. ***** FOR DELUXE SKIDTUBE IF APPLICABLE DRILL TOW RING HOLE IN TUBE *****

*****REF TO W/O BATCH:

180 - ***VERIFY C'BOARD IS GOOD***

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - 1- PRIME AS PER DWG AND QSI 005 4.2 PRIMER PRC DESOTO 515X349 BATCH: S152590 2-

PAINT WHITE AS PER DWG AND QSI 005 4.2 PAINT BATCH: S146086

210 - Inspect for foreign object per QSI 024

230 - 1- Install inserts as per Dwg D4168 2-Inspect for Foreign Objects 3-Install blade fitting D3488-4, wearshoes and ground handling hardware as per dwg D4168 SIKA FLEX 241 BATCH: S163446 EXP DATE: 19-1 5-

Coat all exposed fasteners with "LPS Procyon" batch: M133690

250 - If making a D350-636-216 pick kit will only requires: 1 X AN3C37A 1 X AN3C34A 1 X AN3C42A

260 - *****ensure antiseize is on AN8C21A bolts*****

270 - Identify and pack for shipping as per PPPD350-636-024 Location : FG071

275 - record fwd angle: 89.9 Photocopy blue file and type labels per PPP D350-636-024 CHG 001

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐		
Date :	Sequence #:	QTY Affected :		MRB (QSI042)
Description Work Order Deviation		Disposition		Completed By
				Lead hand / Supervisor
				QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		
Other/Details:				

009665

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D2600-3-BENT-RH	Extrusion Bent RH	1 pcs (1 ea)	90-Start up Operation	008830
D2744	Cap	1 pcs (1 ea)	90-Start up Operation	5129559
D2739	350 I-Beam	1 pcs (1 ea)	160-Skiddtubes	5060499
D2743	Crossbolt Spacer	8 pcs (8 ea)	160-Skiddtubes	5140949
ALS4-1032-225	Rivnut	4 Ea (4 ea)	230-HandFinish	5156521
AN3C34A	Bolt	1 Ea (1 ea)	230-HandFinish	5054809
AN3C36A	Bolt	4 Ea (4 ea)	230-HandFinish	5112121
AN3C6A	Bolt	4 Ea (4 ea)	230-HandFinish	FM 136658-1
AN6C44A	Bolt	4 Ea (4 ea)	230-HandFinish	5142453
AN8C35A	Bolt	1 Ea (1 ea)	230-HandFinish	5149189
D2745	Bushing	8 Ea (8 ea)	230-HandFinish	5142143
D3488-4	Blade Fitting, RH	1 Ea (1 ea)	230-HandFinish	5137492
D3631-1	Washer	8 pcs (8 ea)	230-HandFinish	5148186
D3873-1	Bushing	7 pcs (7 ea)	230-HandFinish	5058407
D4154-041	Wearplate Assembly	1 Ea (1 ea)	230-HandFinish	5154066
D4170-1	Bushing	4 pcs (4 ea)	230-HandFinish	X 5173913
D4171-1	Bushing	1 pcs (1 ea)	230-HandFinish	5137508
MS21043-3	Nut	5 Ea (5 ea)	230-HandFinish	5142731
MS21043-6	Nut	4 Ea (4 ea)	230-HandFinish	5099569
MS21083C8	Nut	1 Ea (1 ea)	230-HandFinish	5149193
NAS1149C0332R	Washer	4 Ea (4 ea)	230-HandFinish	5104046
NAS1149C0363R	Washer	9 Ea (9 ea)	230-HandFinish	5148669
NAS1149C0832R	Washer	1 Ea (1 ea)	230-HandFinish	5076072
NAS1515H3L	Washer	4 Ea (4 ea)	230-HandFinish	5135100
AN3C37A	Bolt	1 Ea (1 ea)	250-Packaging	5083559
AN8C21A	Bolt	2 Ea (2 ea)	250-Packaging	5162124
D2741	Replacement Blade	1 Ea (1 ea)	250-Packaging	5176381
MS21083C8	Nut	2 Ea (2 ea)	250-Packaging	5129318
NAS1149D0863J	Washer	2 Ea (2 ea)	250-Packaging	5117203
				5166718

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2600-3-BENT-RH	1	8	0
	D2744	1	5	0
160-Skiddtubes	D2739	1	7	0
	D2743	8	40	0
230-HandFinish	ALS4-1032-225	4	816	0
	AN3C34A	1	12	0
	AN3C36A	4	392	0
	AN3C6A	4	184	0
	AN6C44A	4	65	0
	AN8C35A	1	35	0
	D2745	8	130	0
	D3488-4	1	0	0
	D3631-1	8	329	0
	D3873-1	7	50	0
	D4154-041	1	0	0
	D4170-1	4	40	0
	D4171-1	1	16	0
	MS21043-3	5	805	0
	MS21043-6	4	91	0
	MS21083C8	1	63	0
	NAS1149C0332R	4	3,718	0
	NAS1149C0363R	9	687	0
	NAS1149C0832R	1	356	0
	NAS1515H3L	4	414	0
250-Packaging	AN3C37A	1	53	0
	AN8C21A	2	35	0
	D2741	1	54	0
	MS21083C8	2	63	0
	NAS1149D0863J	2	135	0

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Part Specifications
Specifications could not be found.

Plex 1/16/19 3:34 PM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

QTY -041	QTY -042	QTY -043	QTY -044	QTY -051	QTY -052	P/N	DESCRIPTION
X						D4168-041	350 SKIDTUBE ASSEMBLY, LH
	X					D4168-042	350 SKIDTUBE ASSEMBLY, RH
		X				D4168-043	350 SKIDTUBE ASSEMBLY, LH
			X			D4168-044	350 SKIDTUBE ASSEMBLY, RH
				X		D4168-051	350 SKIDTUBE ASSEMBLY, LH
					X	D4168-052	350 SKIDTUBE ASSEMBLY, RH
1	1	1	1	1	1	D2739	WEB
8	8	8	8	8	8	D2743	CROSS BOLT SPACER
1	1	1	1	1	1	D2744	CAP
8	8	8	8	8	8	D2745	BUSHING
1		1		1		D3488-3	BLADE FITTING, LH
	1		1		1	D3488-4	BLADE FITTING, RH
4	4	4	4			D3490-1	CROSS BOLT SPACER
4	4					D3490-3	CROSS BOLT SPACER
		4	4			D3490-5	CROSS BOLT SPACER
8	8	8	8			D3492-041	PLUG ASSEMBLY
8	8					D3492-043	PLUG ASSEMBLY
		8	8			D3492-045	PLUG ASSEMBLY
8	8	8	8	8	8	D3631-1	WASHER
7	7	7	7	7	7	D3873-1	BUSHING
1	1	1	1	1	1	D4154-041	WEARPLATE ASSEMBLY
1						D4168-1	SKIDTUBE WELDMENT, LH
	1					D4168-2	SKIDTUBE WELDMENT, RH
		1				D4168-3	SKIDTUBE WELDMENT, LH
			1			D4168-4	SKIDTUBE WELDMENT, RH
				1		D4168-5	SKIDTUBE WELDMENT, LH
					1	D4168-6	SKIDTUBE WELDMENT, RH
4	4	4	4	4	4	D4170-1	SPACER
1	1	1	1	1	1	D4171-1	BUSHING
4	4	4	4	4	4	ALS4-1032-225	INSERT
1	1	1	1	1	1	AN3C34A	BOLT
4	4	4	4	4	4	AN3C36A	BOLT
4	4	4	4	4	4	AN3C6A	BOLT
4	4	4	4	4	4	AN8C44A	BOLT
1	1	1	1	1	1	AN8C35A	BOLT
5	5	5	5	5	5	MS21043-3	NUT
4	4	4	4	4	4	MS21043-6	NUT
1	1	1	1	1	1	MS21083C8	NUT
4	4	4	4	4	4	NAS1149C0332R	WASHER
9	9	9	9	9	9	NAS1149C0363R	WASHER
1	1	1	1	1	1	NAS1149C0832R	WASHER
4	4	4	4	4	4	NAS1515H3L	WASHER

NOTES:

- 1) MATERIAL: MAKE D4168-1/-2/-3/-4/-5/-6 FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB. STANDARD: PRIME (REF. 4.2.1.3.3) AND PAINT WHITE PER DART QSI 005 4.3. OPTIONAL: POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3. BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: D4168-041/-042/-043/-044 = 32.3 lbs
D4168-051/-052 = 31.9 lbs
- 8) WELD PER DART QSI 004
- 9) FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 KSI
MINIMUM ULTIMATE TENSILE STRENGTH = 38 KSI
- 10) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF FINISH WITH MEK DEGREASER.
- 11) SPACER AND PLUG INSTALLED SAME AS SECTION AJ-AJ EXCEPT HORIZONTAL
- 12) SPACER AND PLUG INSTALLED SAME AS SECTION AP-AP EXCEPT HORIZONTAL

C	ADDED -051/-052 (ZN D5-1 SHEETS 4, 15-16); ADDED D4168-5/-6 (ZN B5-1, SHEETS 8, 10); D3488-3/-4 REPLACES D3488-041/-042 (ZN C5-1, D2-11, D2-12, D2-14); ADDED NOTES 13, 14 (ZN C4-1); NAS1149C0363R WAS AN960C10 (ZN A5-1, C8-11, C7-11, D8-11, C8-12, C7-12, D8-12, C8-13, C7-13, D8-13, C8-14, C7-14, D8-14); NAS1149C0332R WAS AN960C10L (ZN B1-11, B1-12, B1-13, B1-14); NAS1149C0832R WAS AN960C816L (ZN C1-11, C1-12, C1-13, C1-14)	ZF	18.03.01
B	ADD VIEW TO CONTROL FWD BEND ORIENTATION (ZN D-1-4/-5/-6/-7); UPDATED FINISH OPTIONS. REASON: PAR13-276 AND NCR13-2757	MB	13.07.11
A	NEW ISSUE	SC	10.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	SC	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	ZF		
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 1 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED

2019 OCT 19
2019-03-03

APPROVED

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


8 7 6 5 4 3 2 1

D


C

B

A

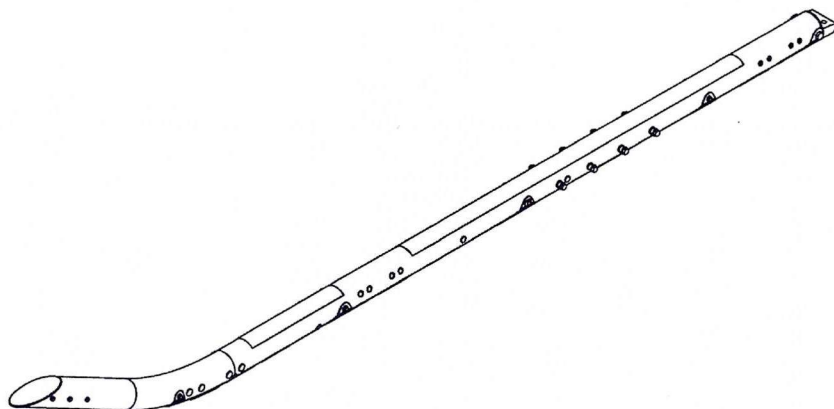

D4168-041 350 SKIDTUBE ASSEMBLY, LH

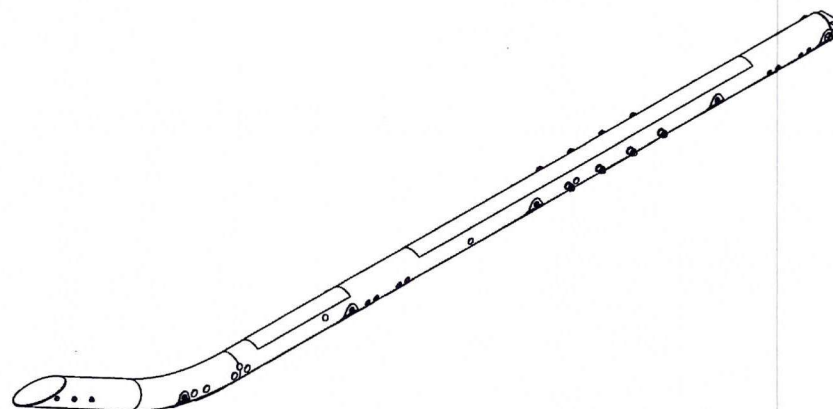

D4168-042 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2018 OCT 19

APPROVED

DESIGN	SC	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 2 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

8 7 6 5 4 3 2 1

D

C

B


A

D


C

B

A

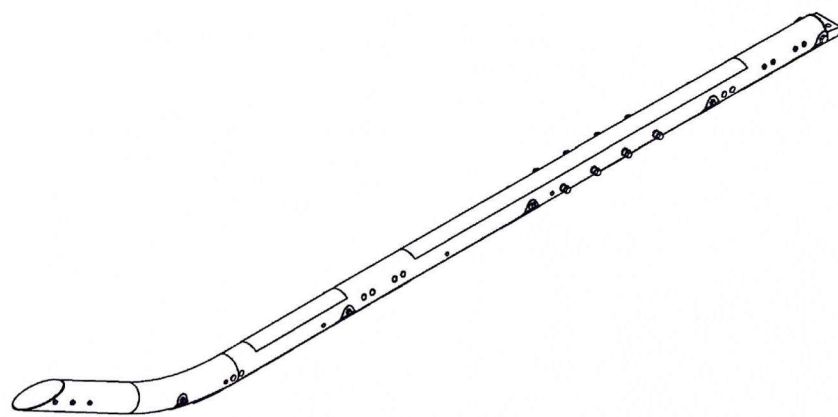

D4168-043 350 SKIDTUBE ASSEMBLY, LH

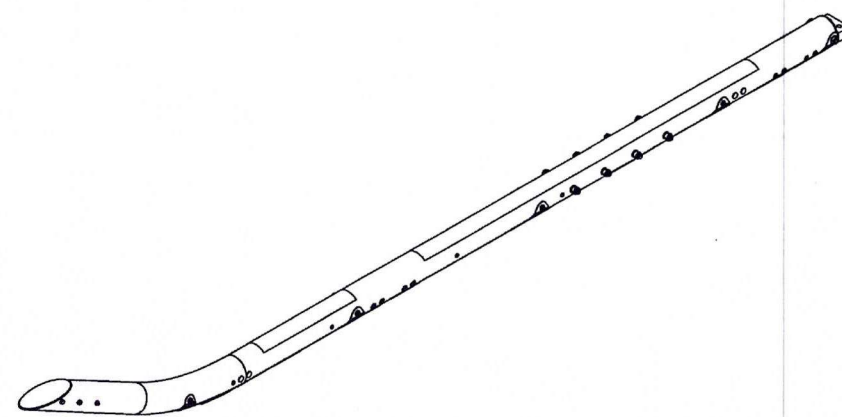

D4168-044 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2018 OCT 19

APPROVED

DESIGN	SC	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	ZF		
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 3 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2018 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

8 7 6 5 4 3 2 1

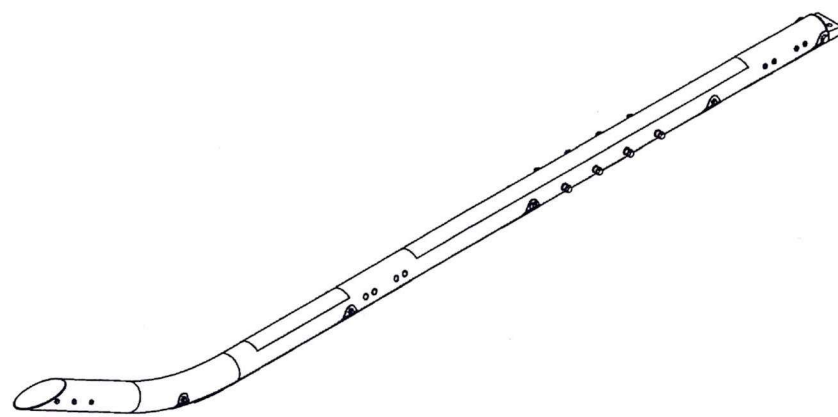

△ D4168-051 350 SKIDTUBE ASSEMBLY, LH

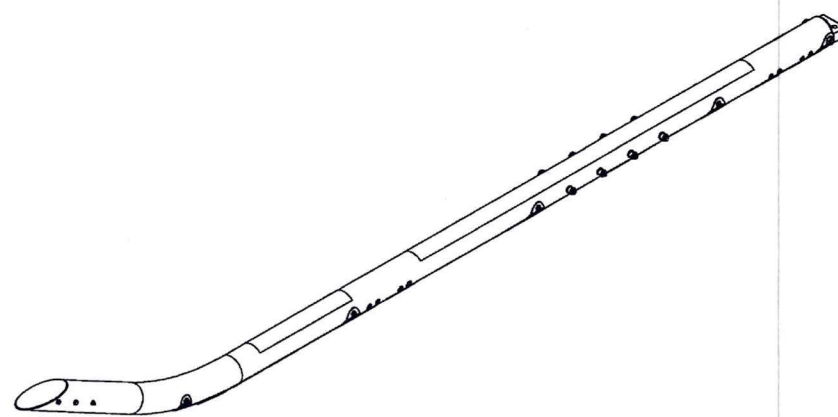

△ D4168-052 350 SKIDTUBE ASSEMBLY, RH

RELEASED
2019 OCT 19

APPROVED

DESIGN	SC	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	ZF		
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 4 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

D
C
B
A

D
C
B
A

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

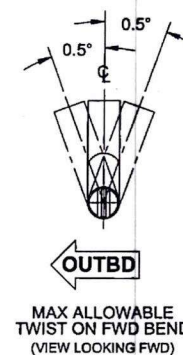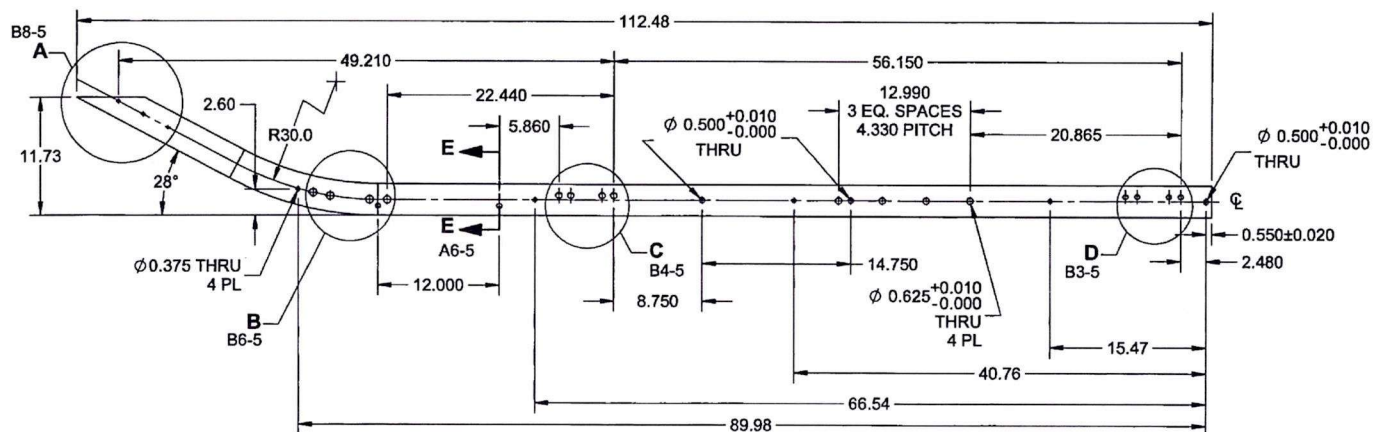


D4168-1 LH SKIDTUBE

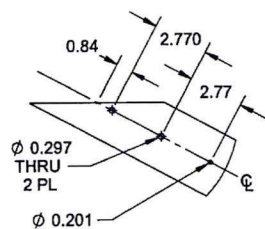


DETAIL A
SCALE 2X

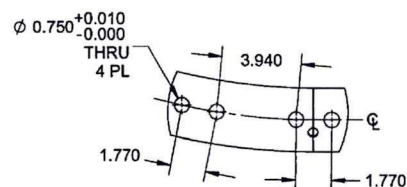


DETAIL B
SCALE 2X

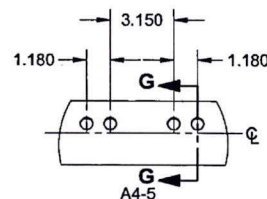


DETAIL C
SCALE 2X

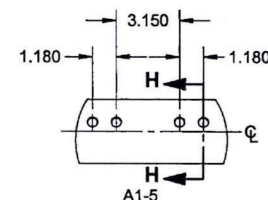


DETAIL D
SCALE 2X

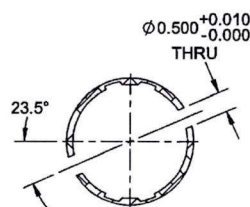

SECTION E-E
SCALE 4X, 2 PL

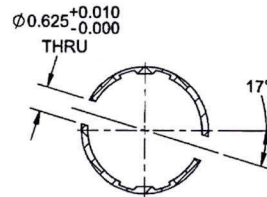

SECTION G-G
SCALE 4X, 4 PL

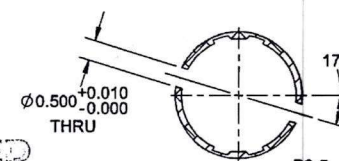

SECTION H-H
SCALE 4X, 4 PL

RELEASED
2010 OCT 19

APPROVED	DESIGN	SC	DART AEROSPACE USA, INC.	
	DRAWN	ZF	EUGENE, OR	
	CHECKED	MW	DRAWING NO.	REV. C
	MFG. APPR.	DD	D4168	SHEET 5 OF 16
	APPROVED	NO	TITLE	SCALE
	DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
	DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐


Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

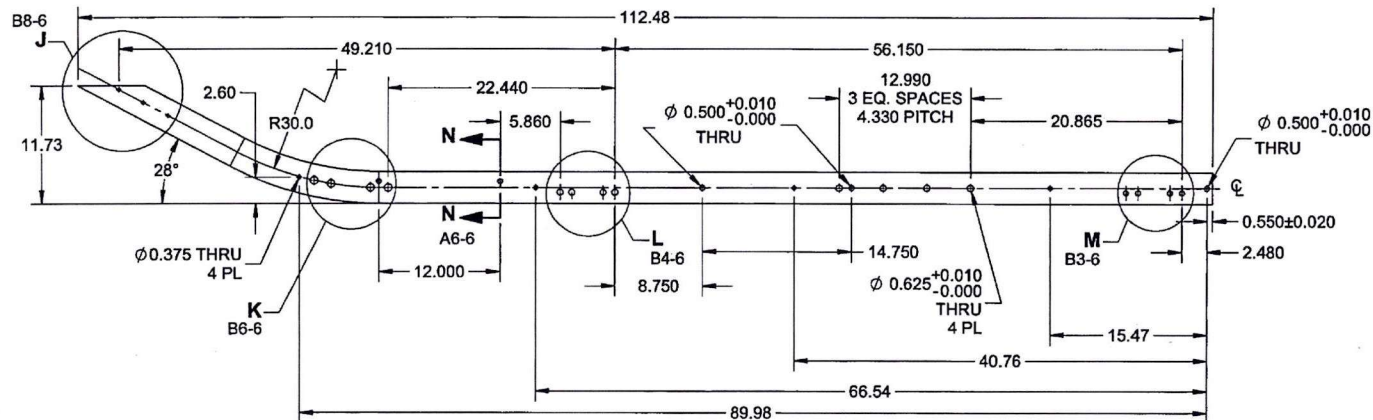


D4168-2 RH SKIDTUBE

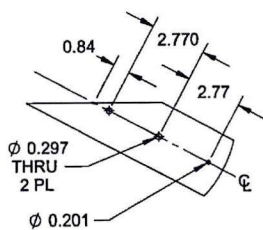


DETAIL J
SCALE 2X

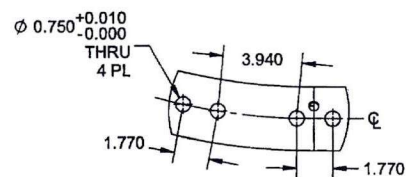


DETAIL K
SCALE 2X

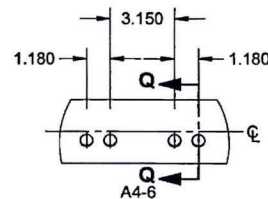


DETAIL L
SCALE 2X

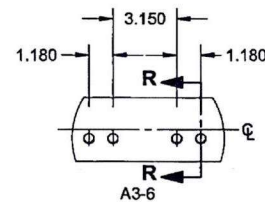


DETAIL M
SCALE 2X

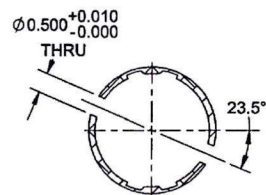


SECTION N-N
SCALE 4X, 2 PL

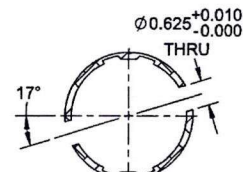

SECTION Q-Q
SCALE 4X, 4 PL

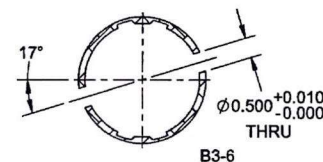

SECTION R-R
SCALE 4X, 4 PL

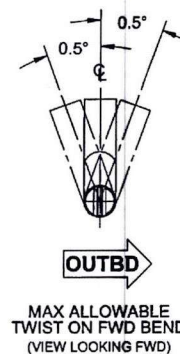

RELEASED

2018 OCT 19

APPROVED

DESIGN	SC
DRAWN	ZF
CHECKED	MW
MFG. APPR.	DD
APPROVED	NO
DE APPR.	DS
DATE	18.03.01

DART AEROSPACE USA, INC.
EUGENE, OR

DRAWING NO. D4168	REV. C SHEET 6 OF 16
TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

COPYRIGHT © 2010 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

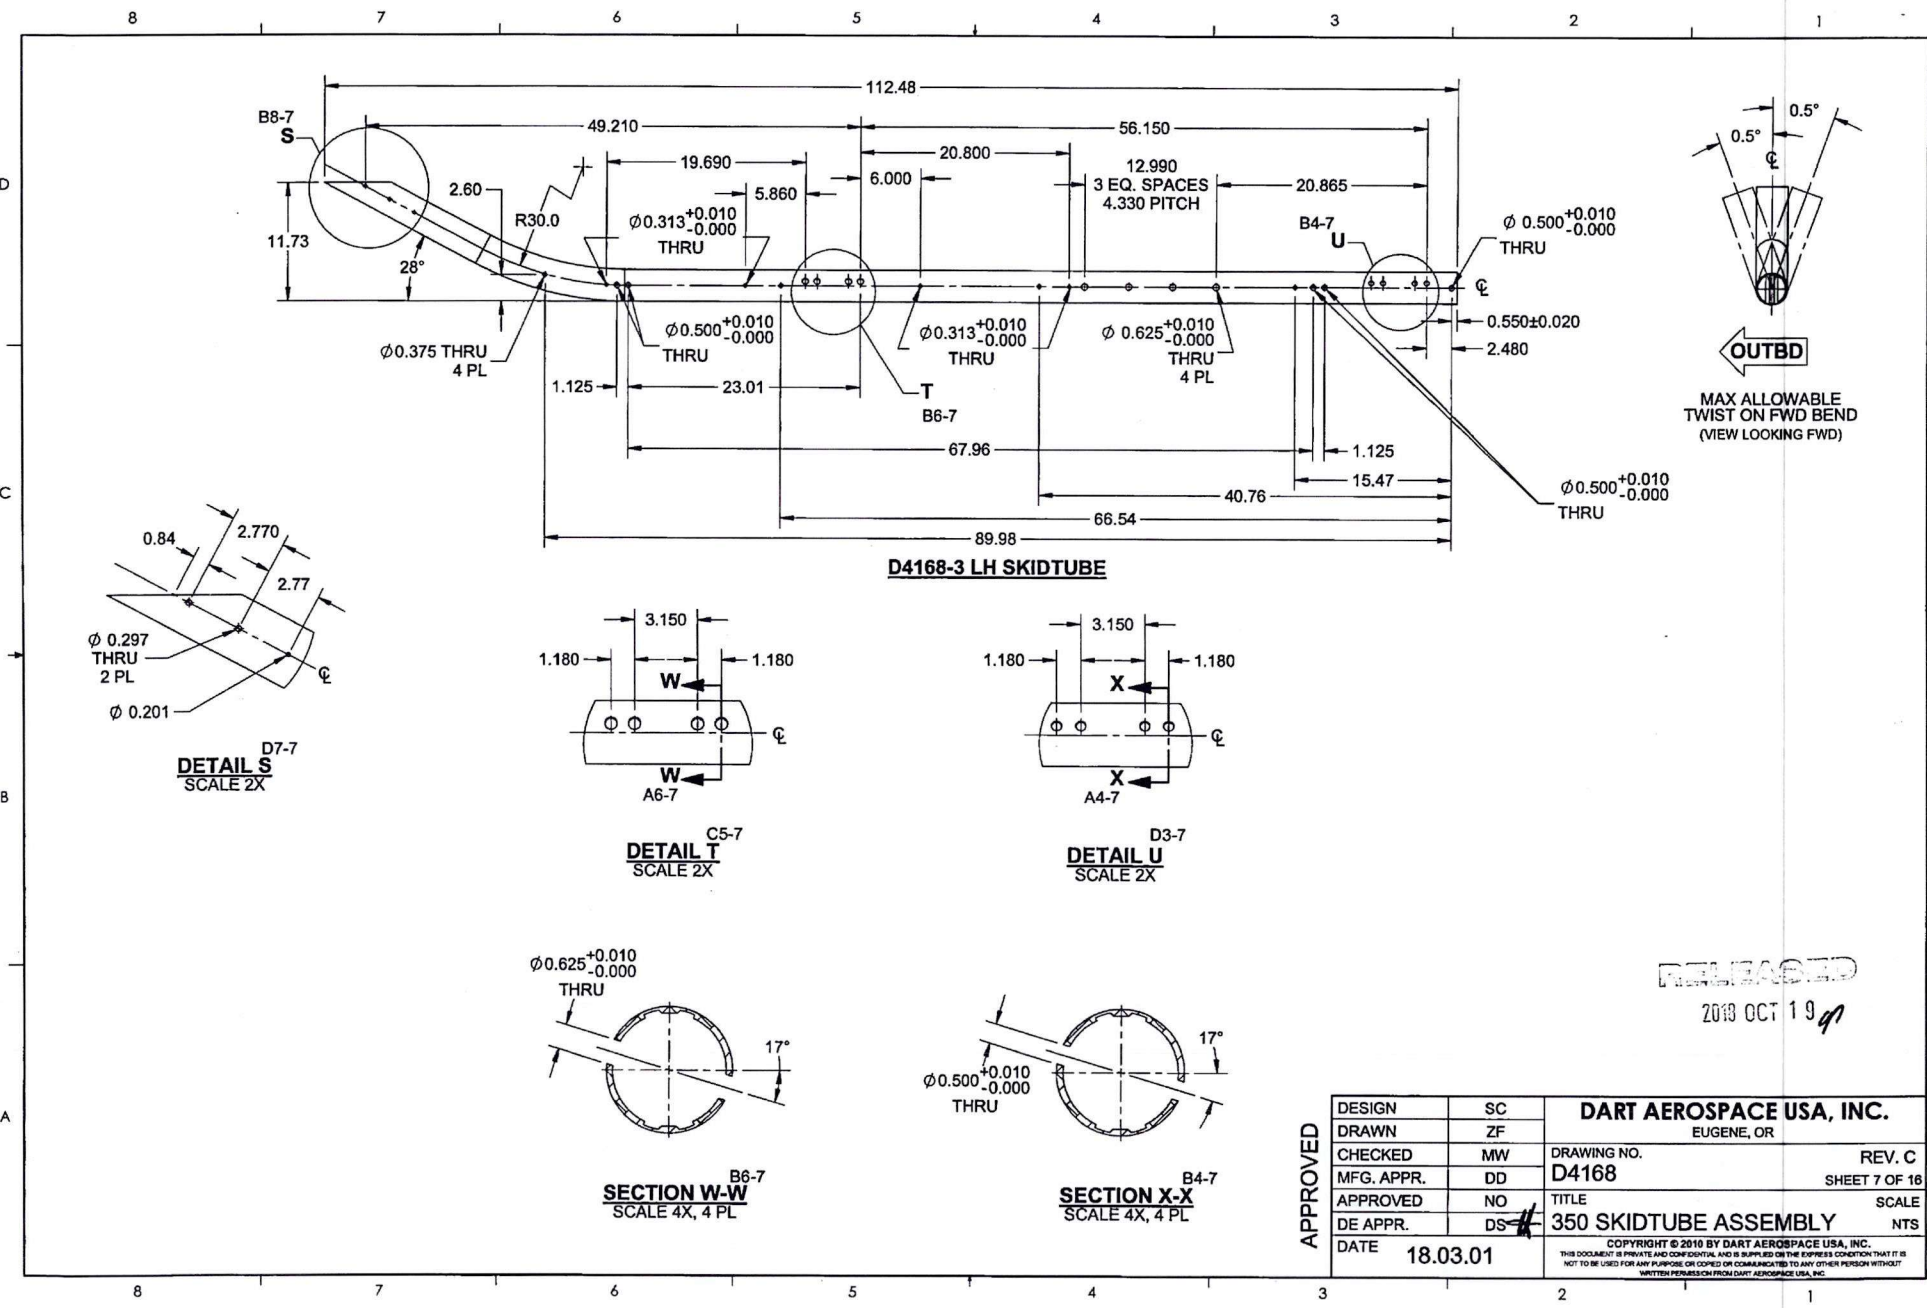

DESIGN	SC	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 7 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QS1042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

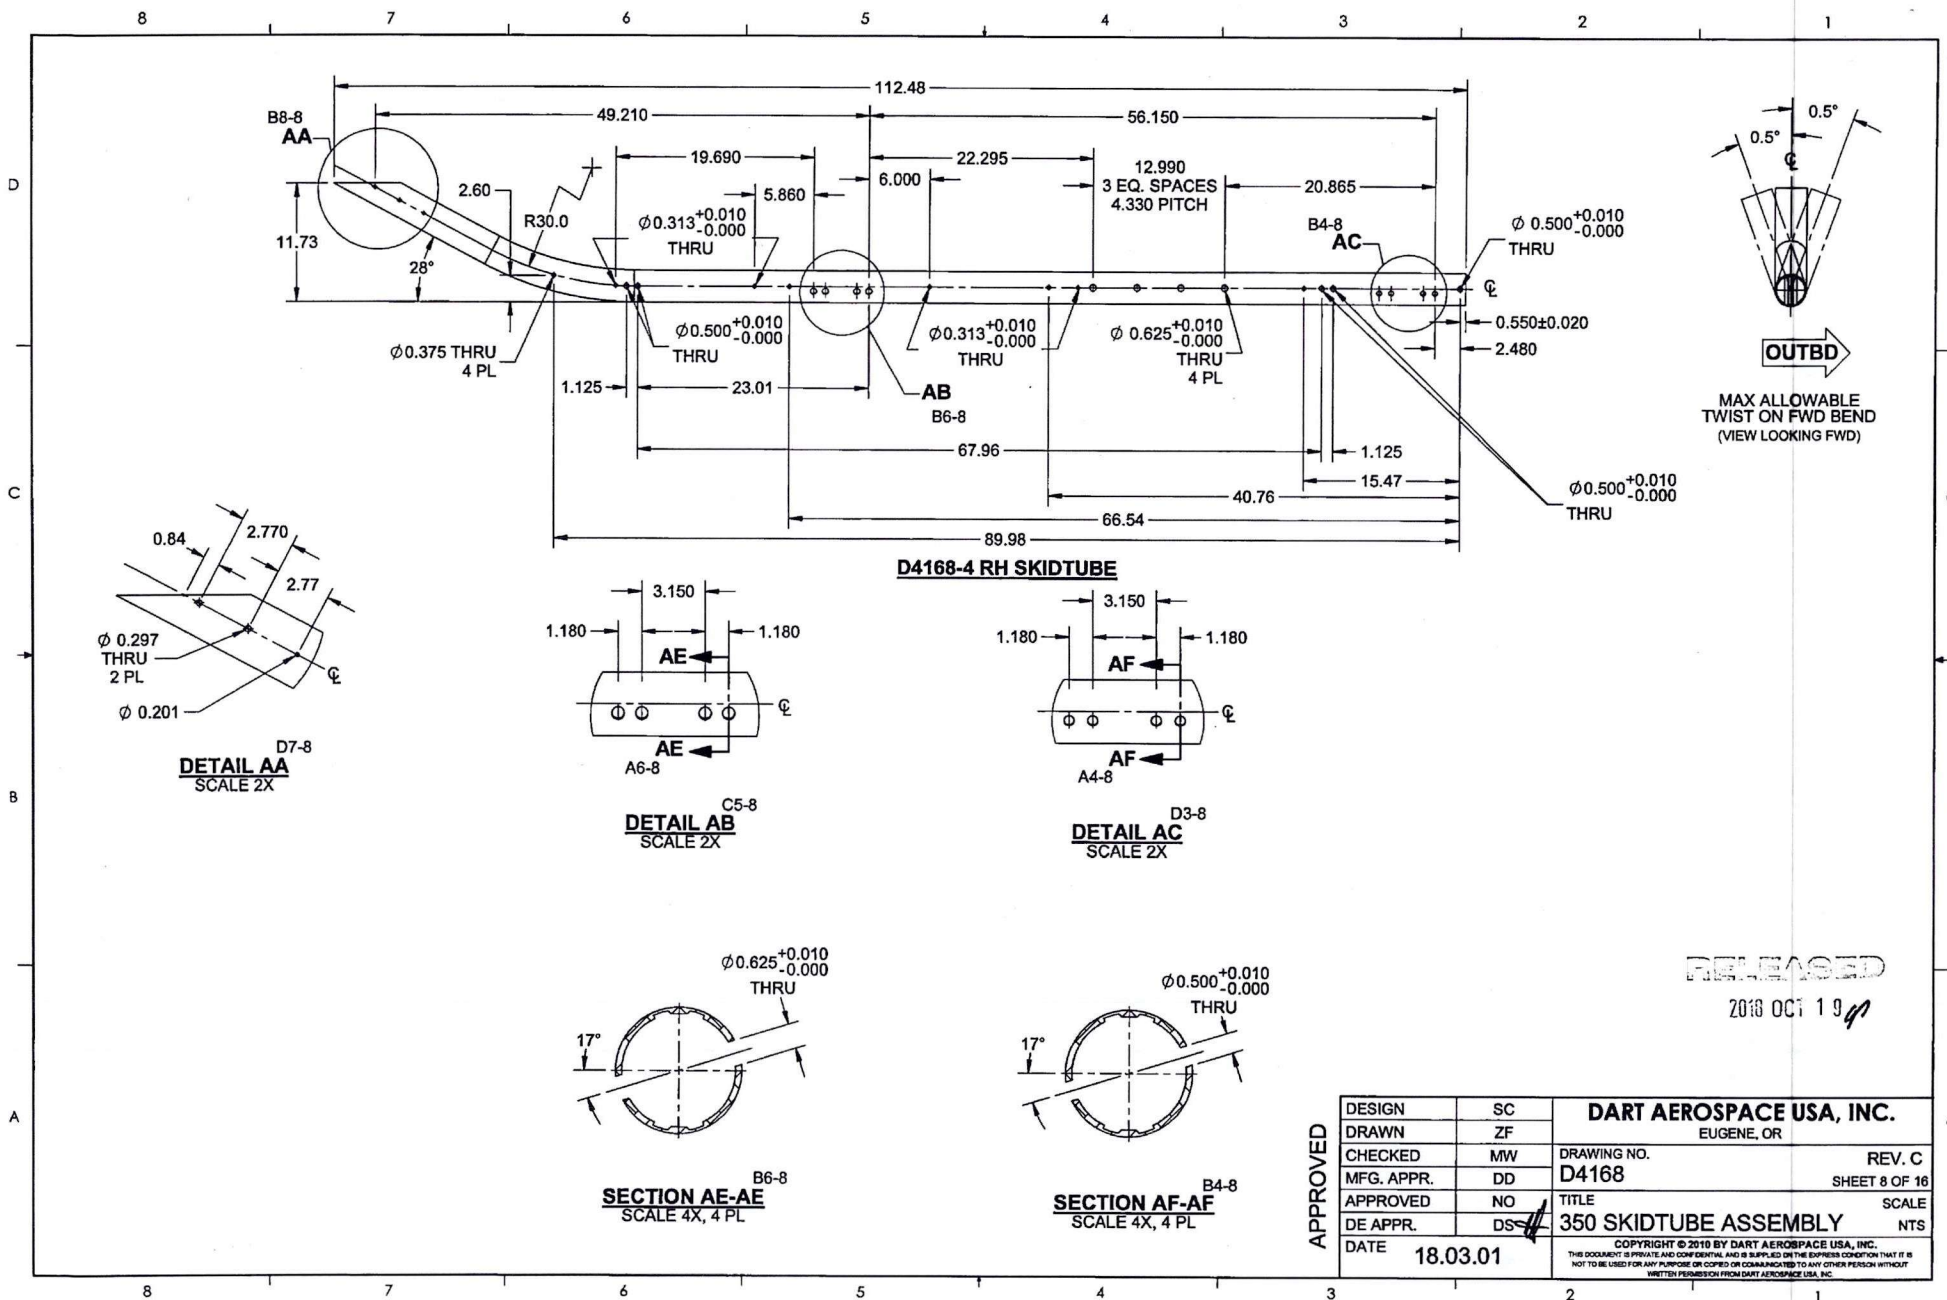

RELEASED
2018 OCT 19

APPROVED	DESIGN	SC	DART AEROSPACE USA, INC.	
	DRAWN	ZF	EUGENE, OR	
	CHECKED	MW	DRAWING NO.	REV. C
	MFG. APPR.	DD	D4168	SHEET 8 OF 16
	APPROVED	NO	TITLE	SCALE
	DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE		18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____






WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					


△ D4168-5 LH SKIDTUBE

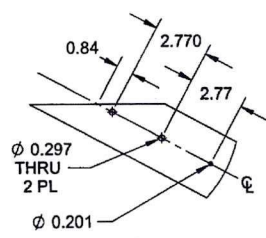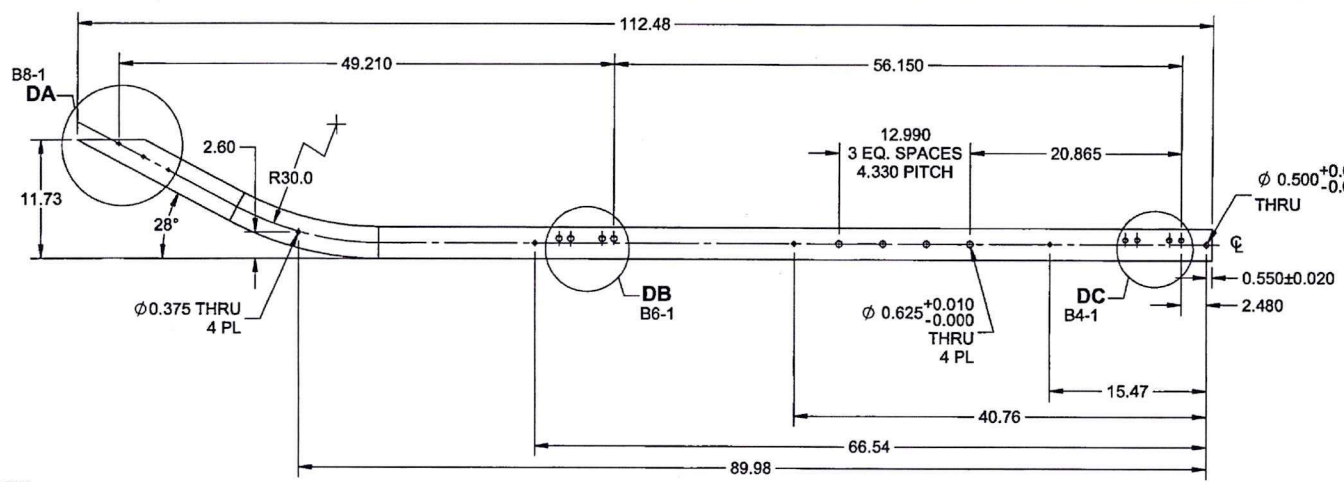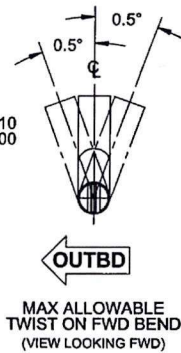


DETAIL DA
SCALE 2X

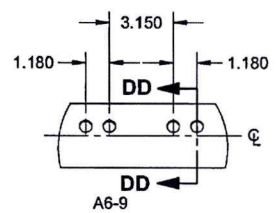


DETAIL DB
SCALE 2X

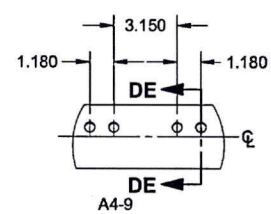

DETAIL DC
SCALE 2X

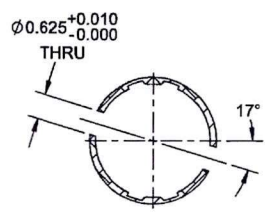

SECTION DD-DD
SCALE 4X, 4 PL

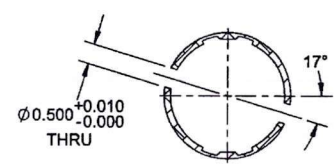

SECTION DE-DE
SCALE 4X, 4 PL

RELEASED
2018 OCT 19

DESIGN	SC	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 9 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

APPROVED

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		FAULT CATEGORY Other/Details:			

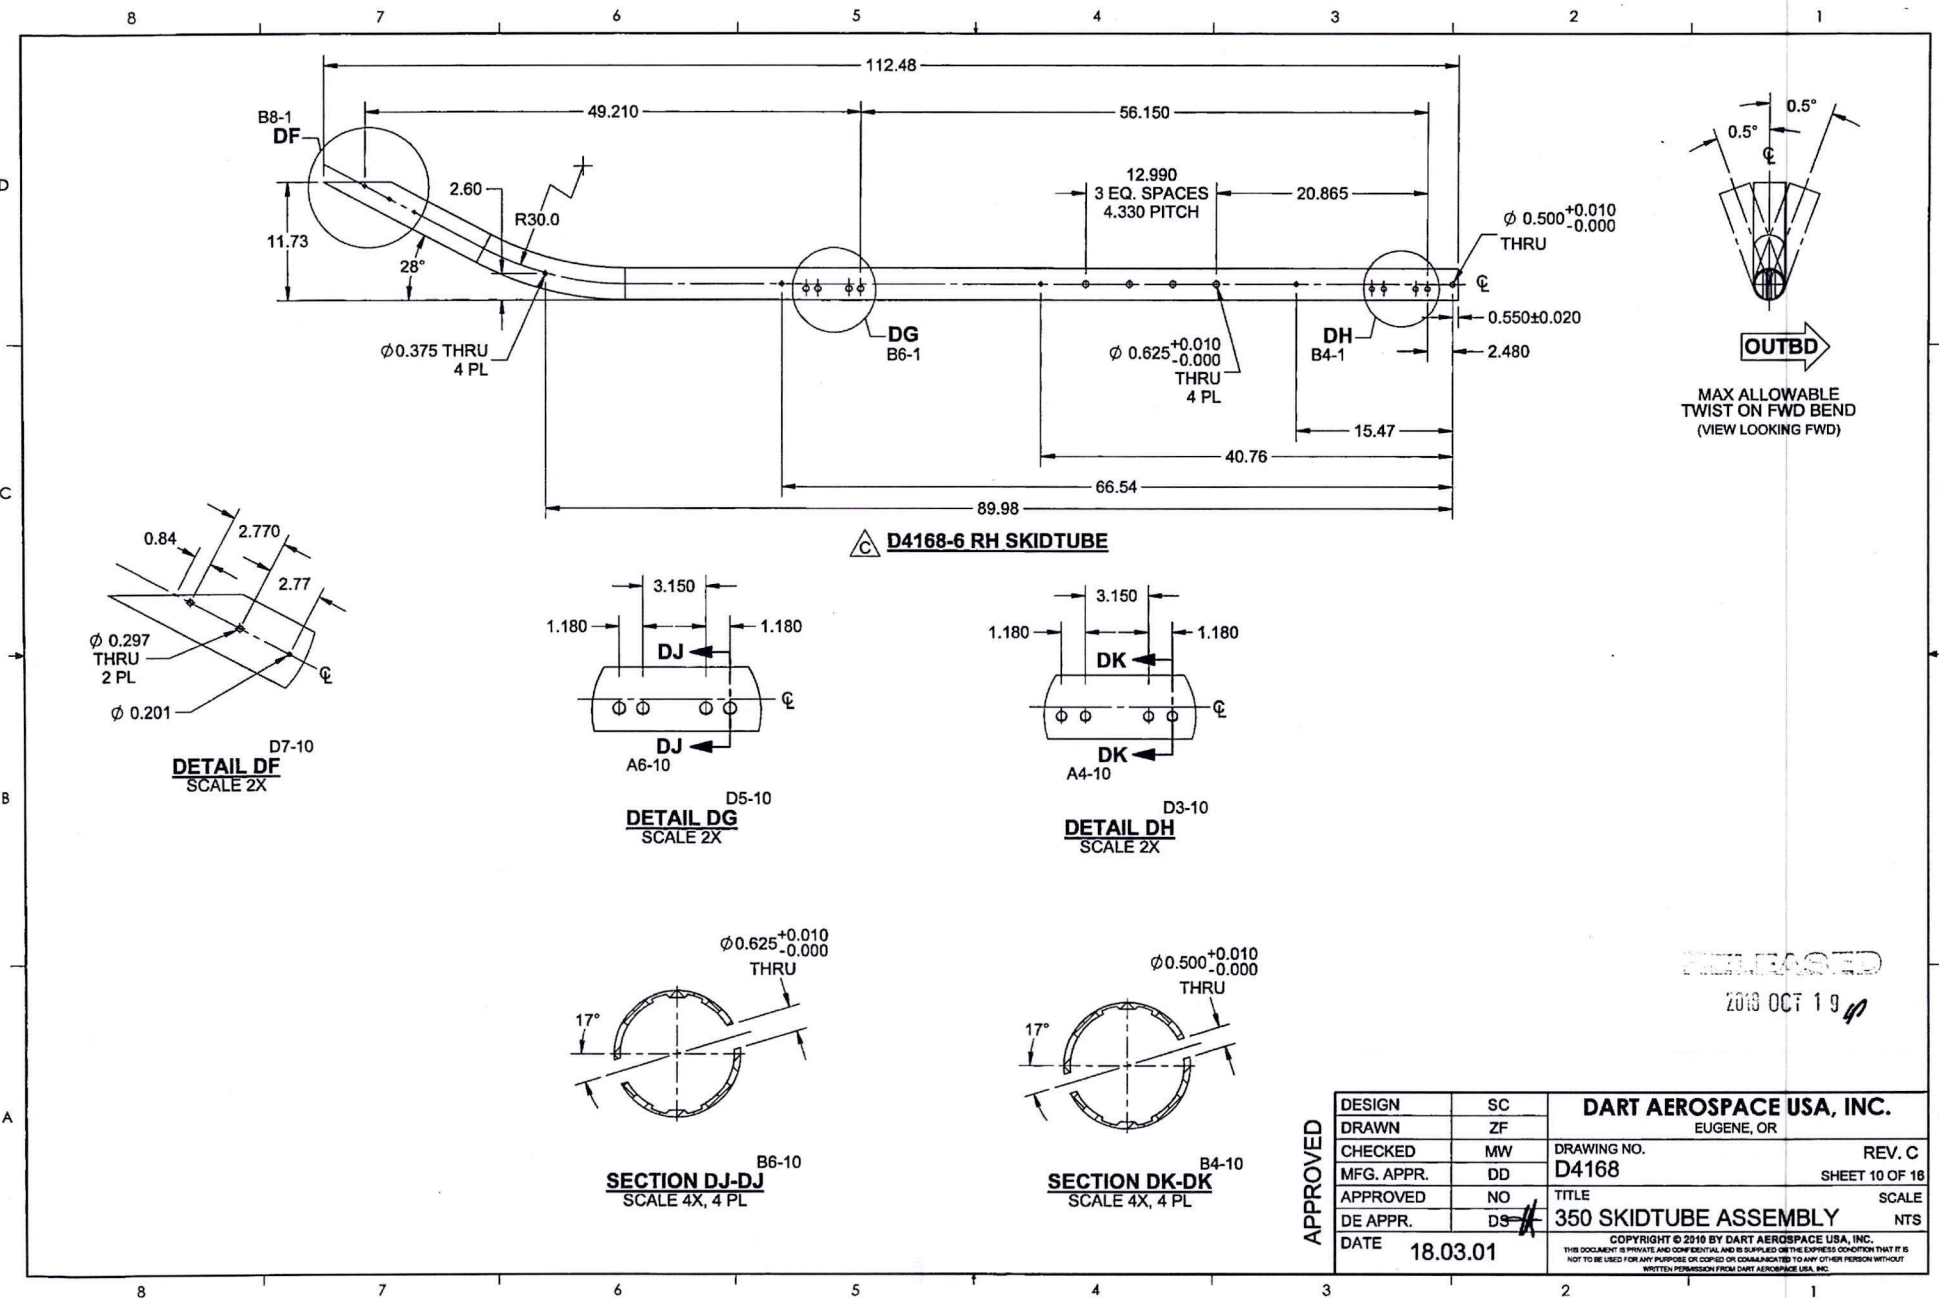

DESIGN	SC	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	ZF		
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 10 OF 18
APPROVED	NO	TITLE	SCALE
DE APPR.	D3	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

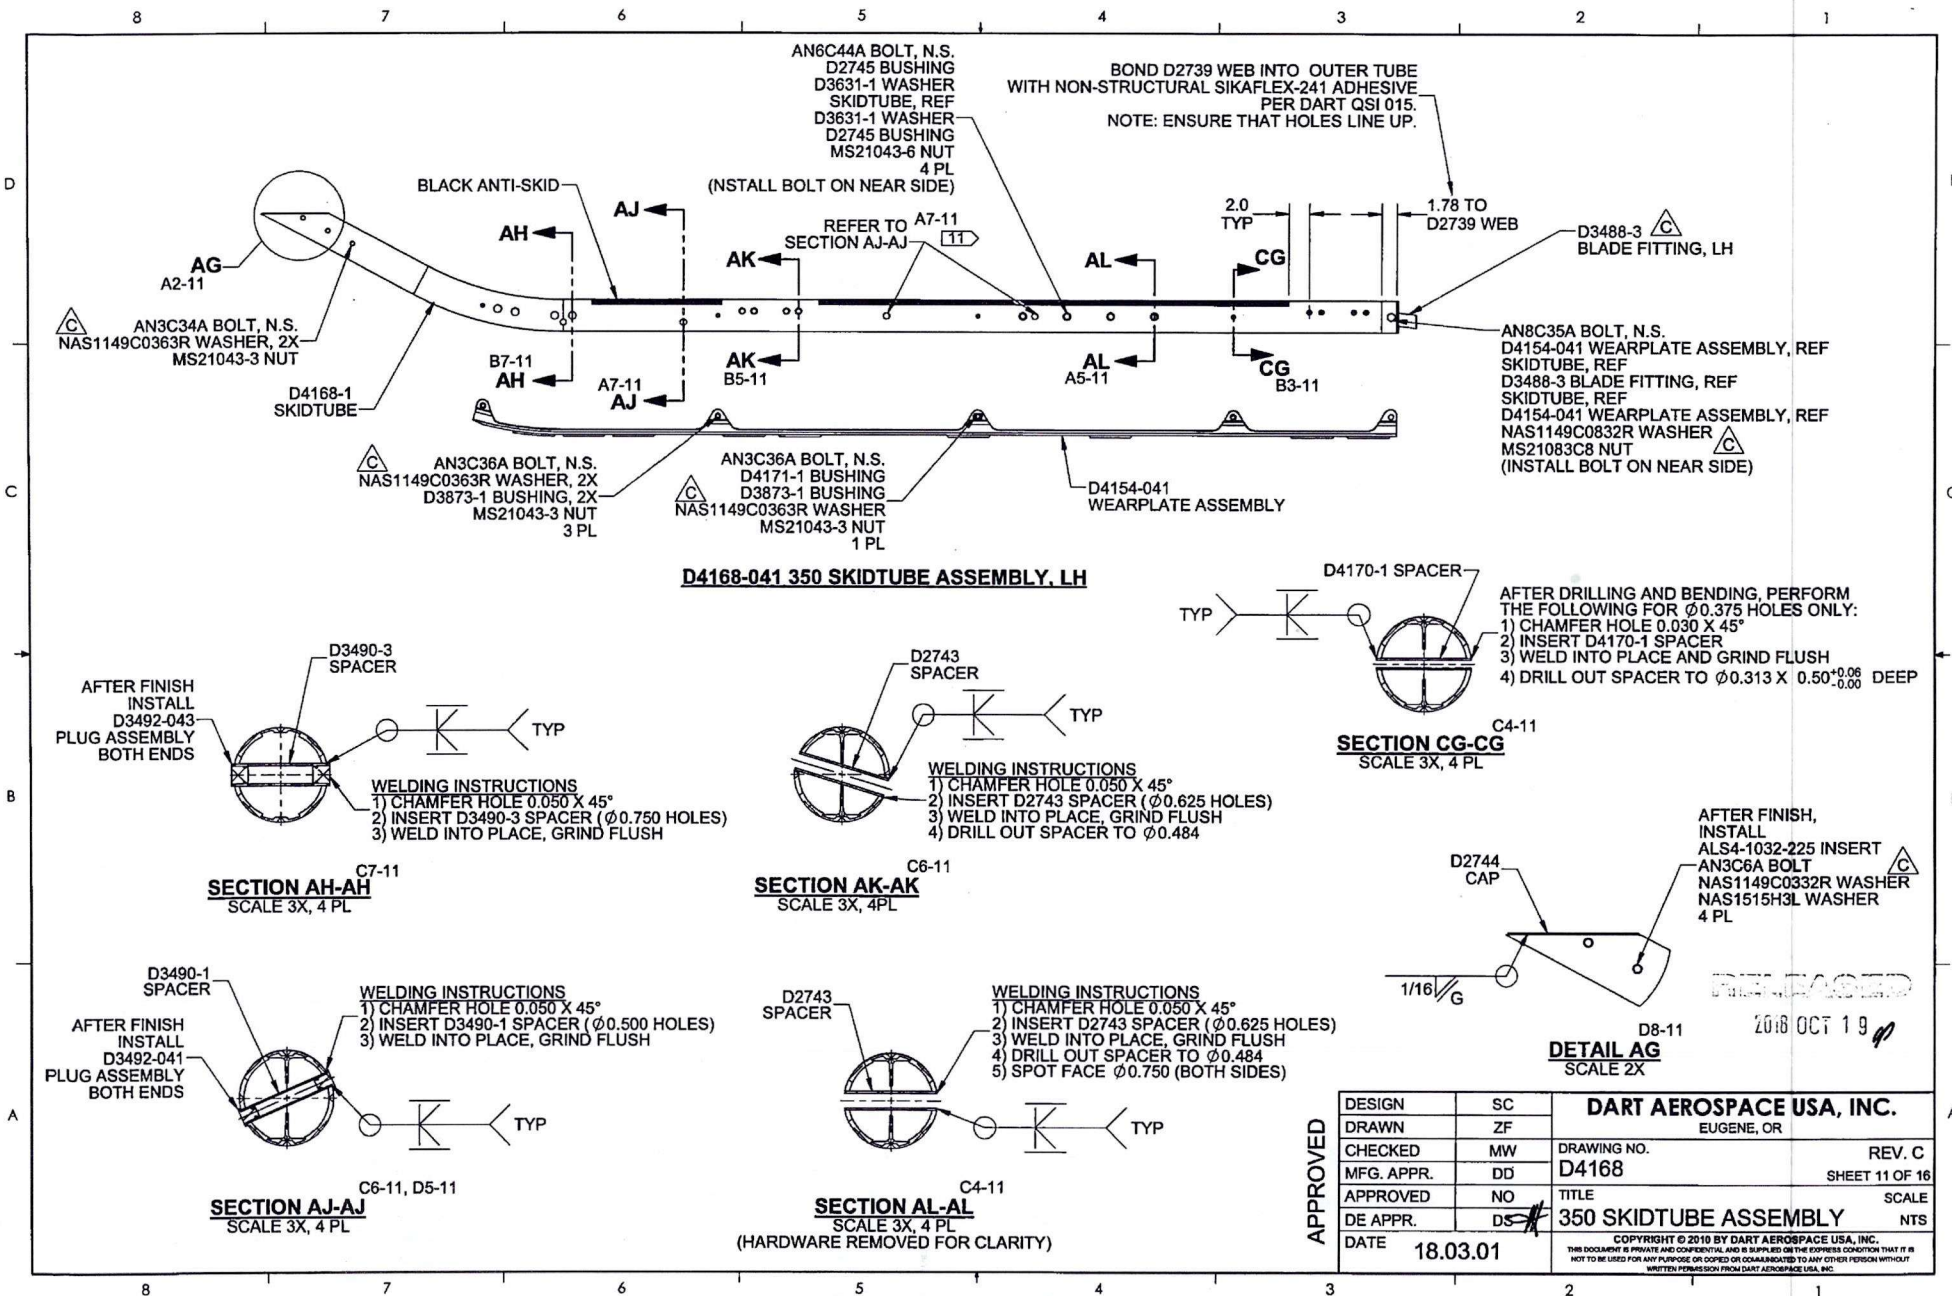

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

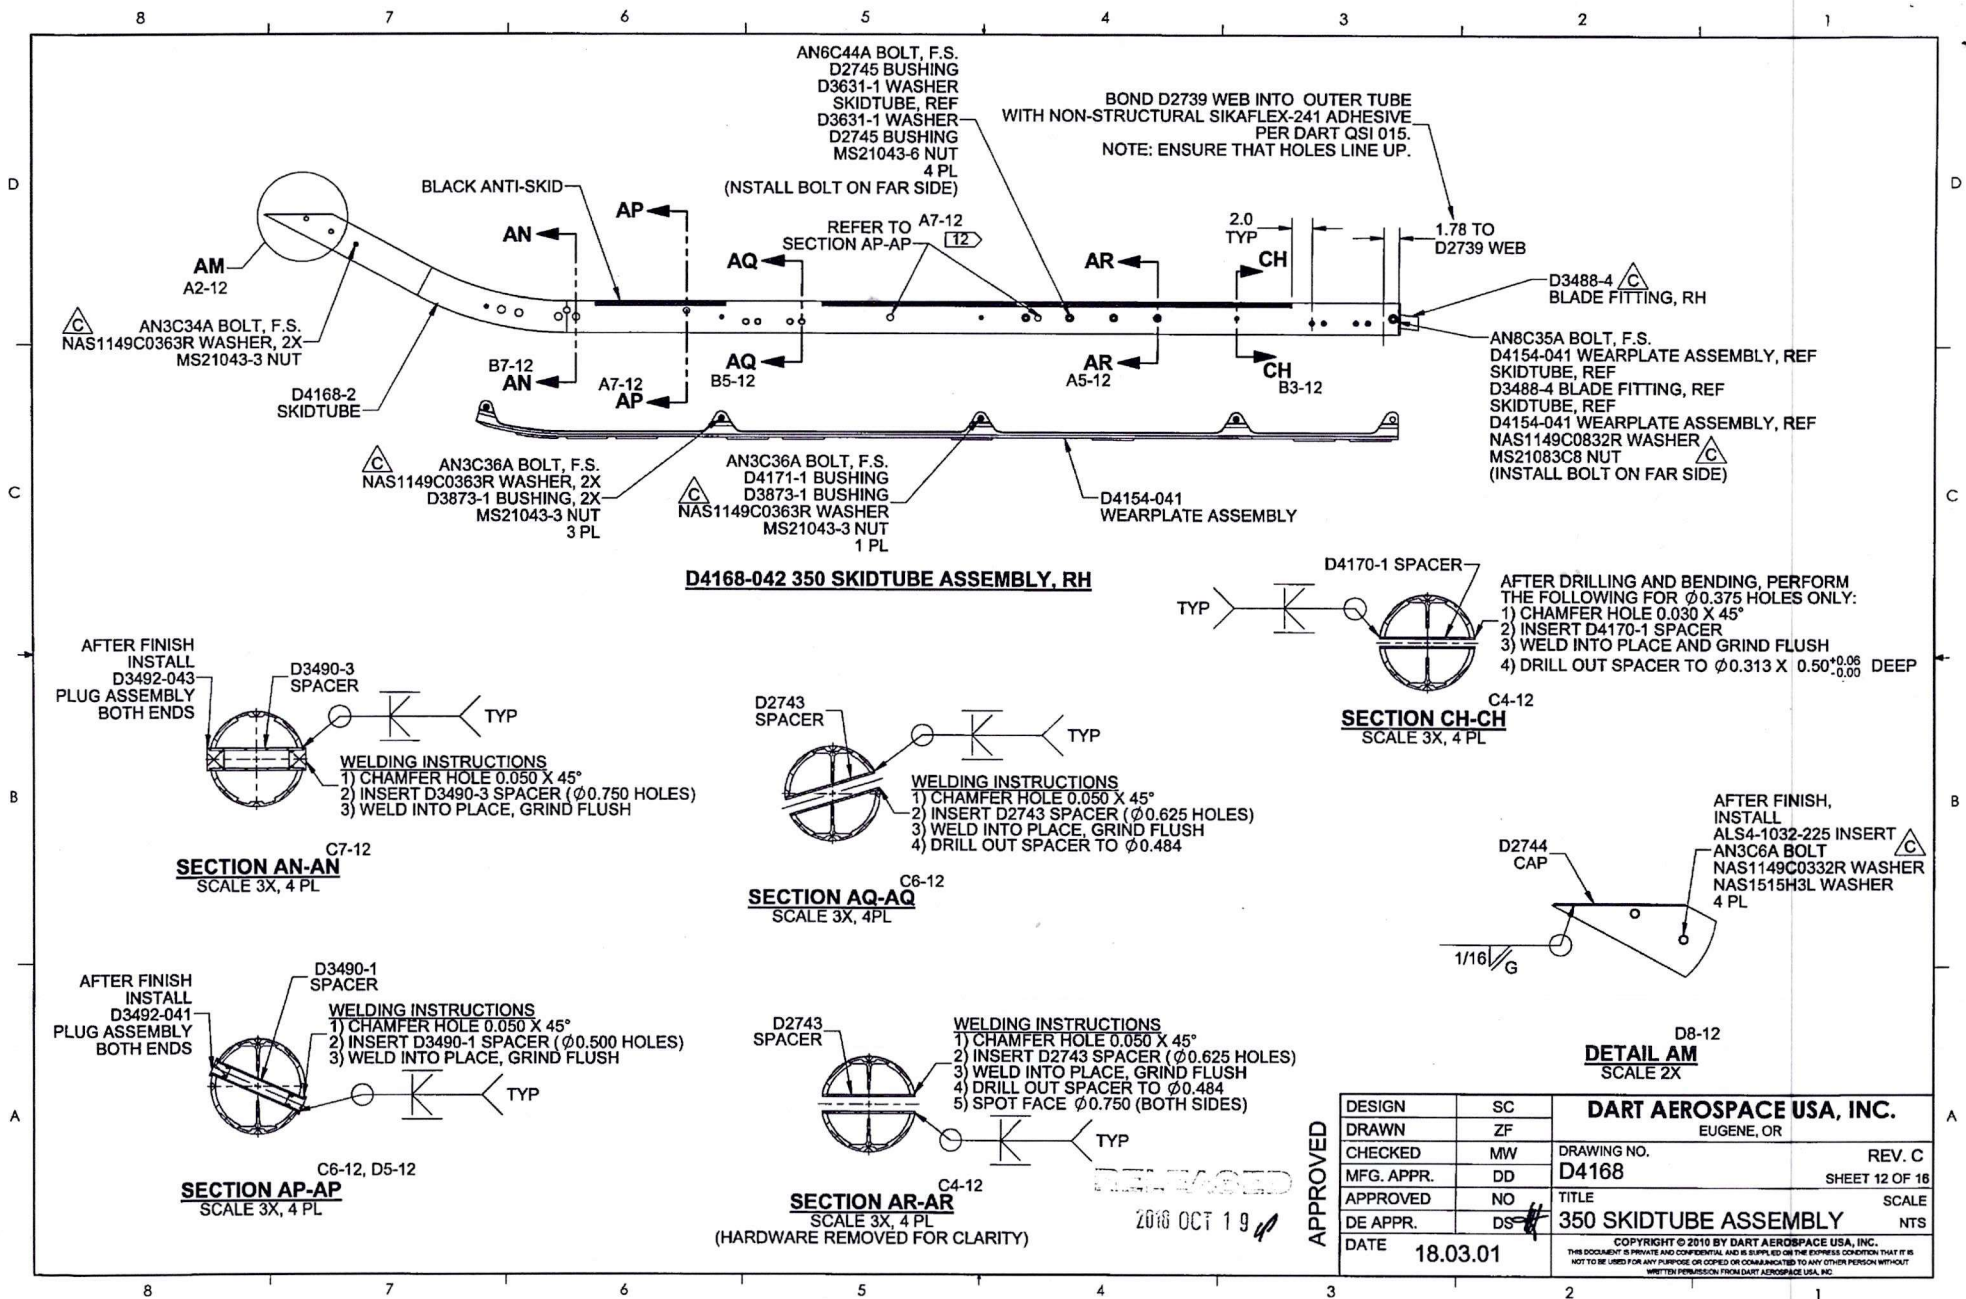

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

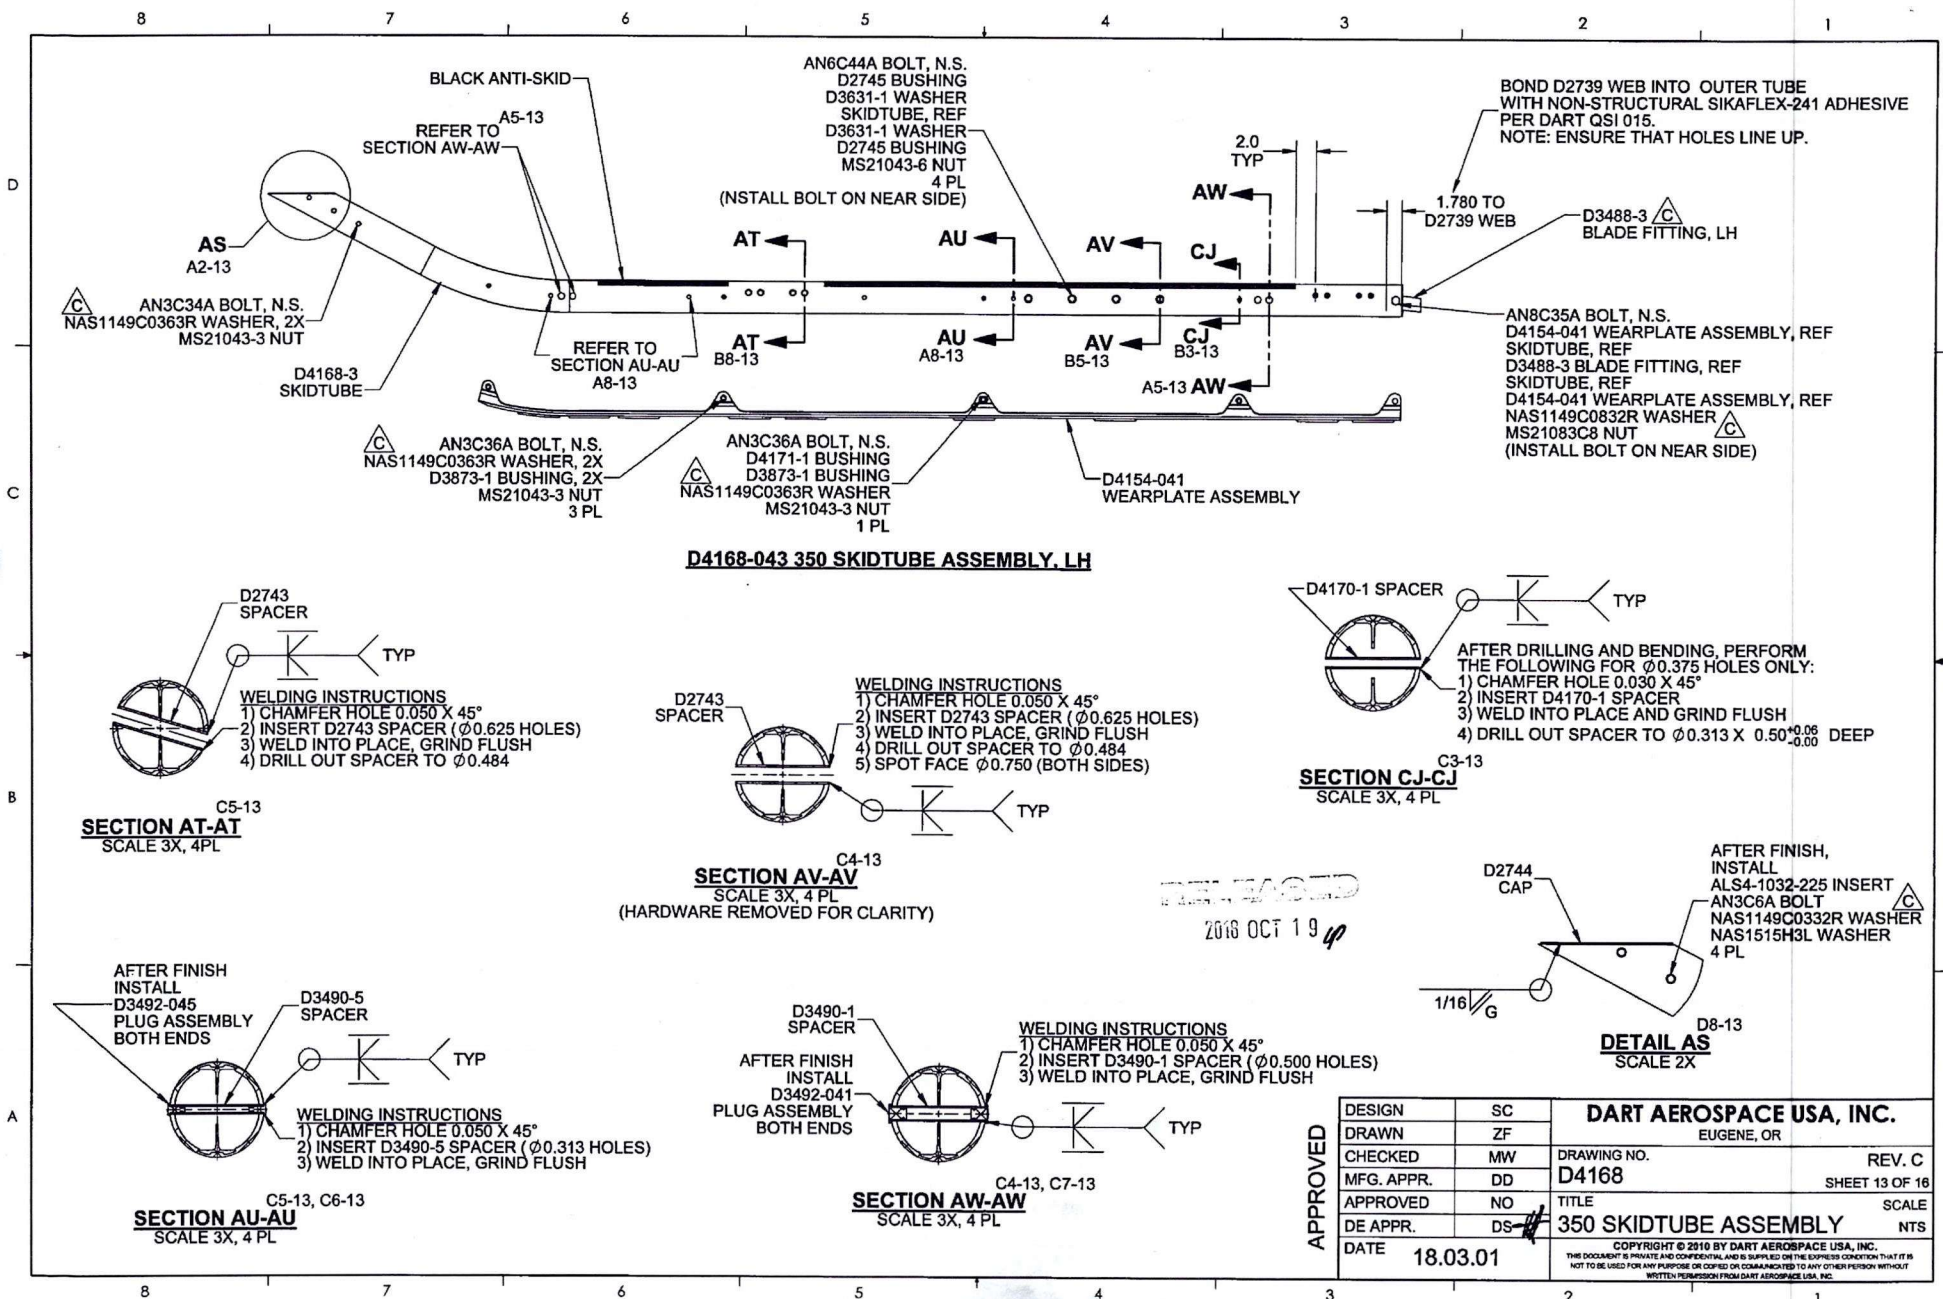

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

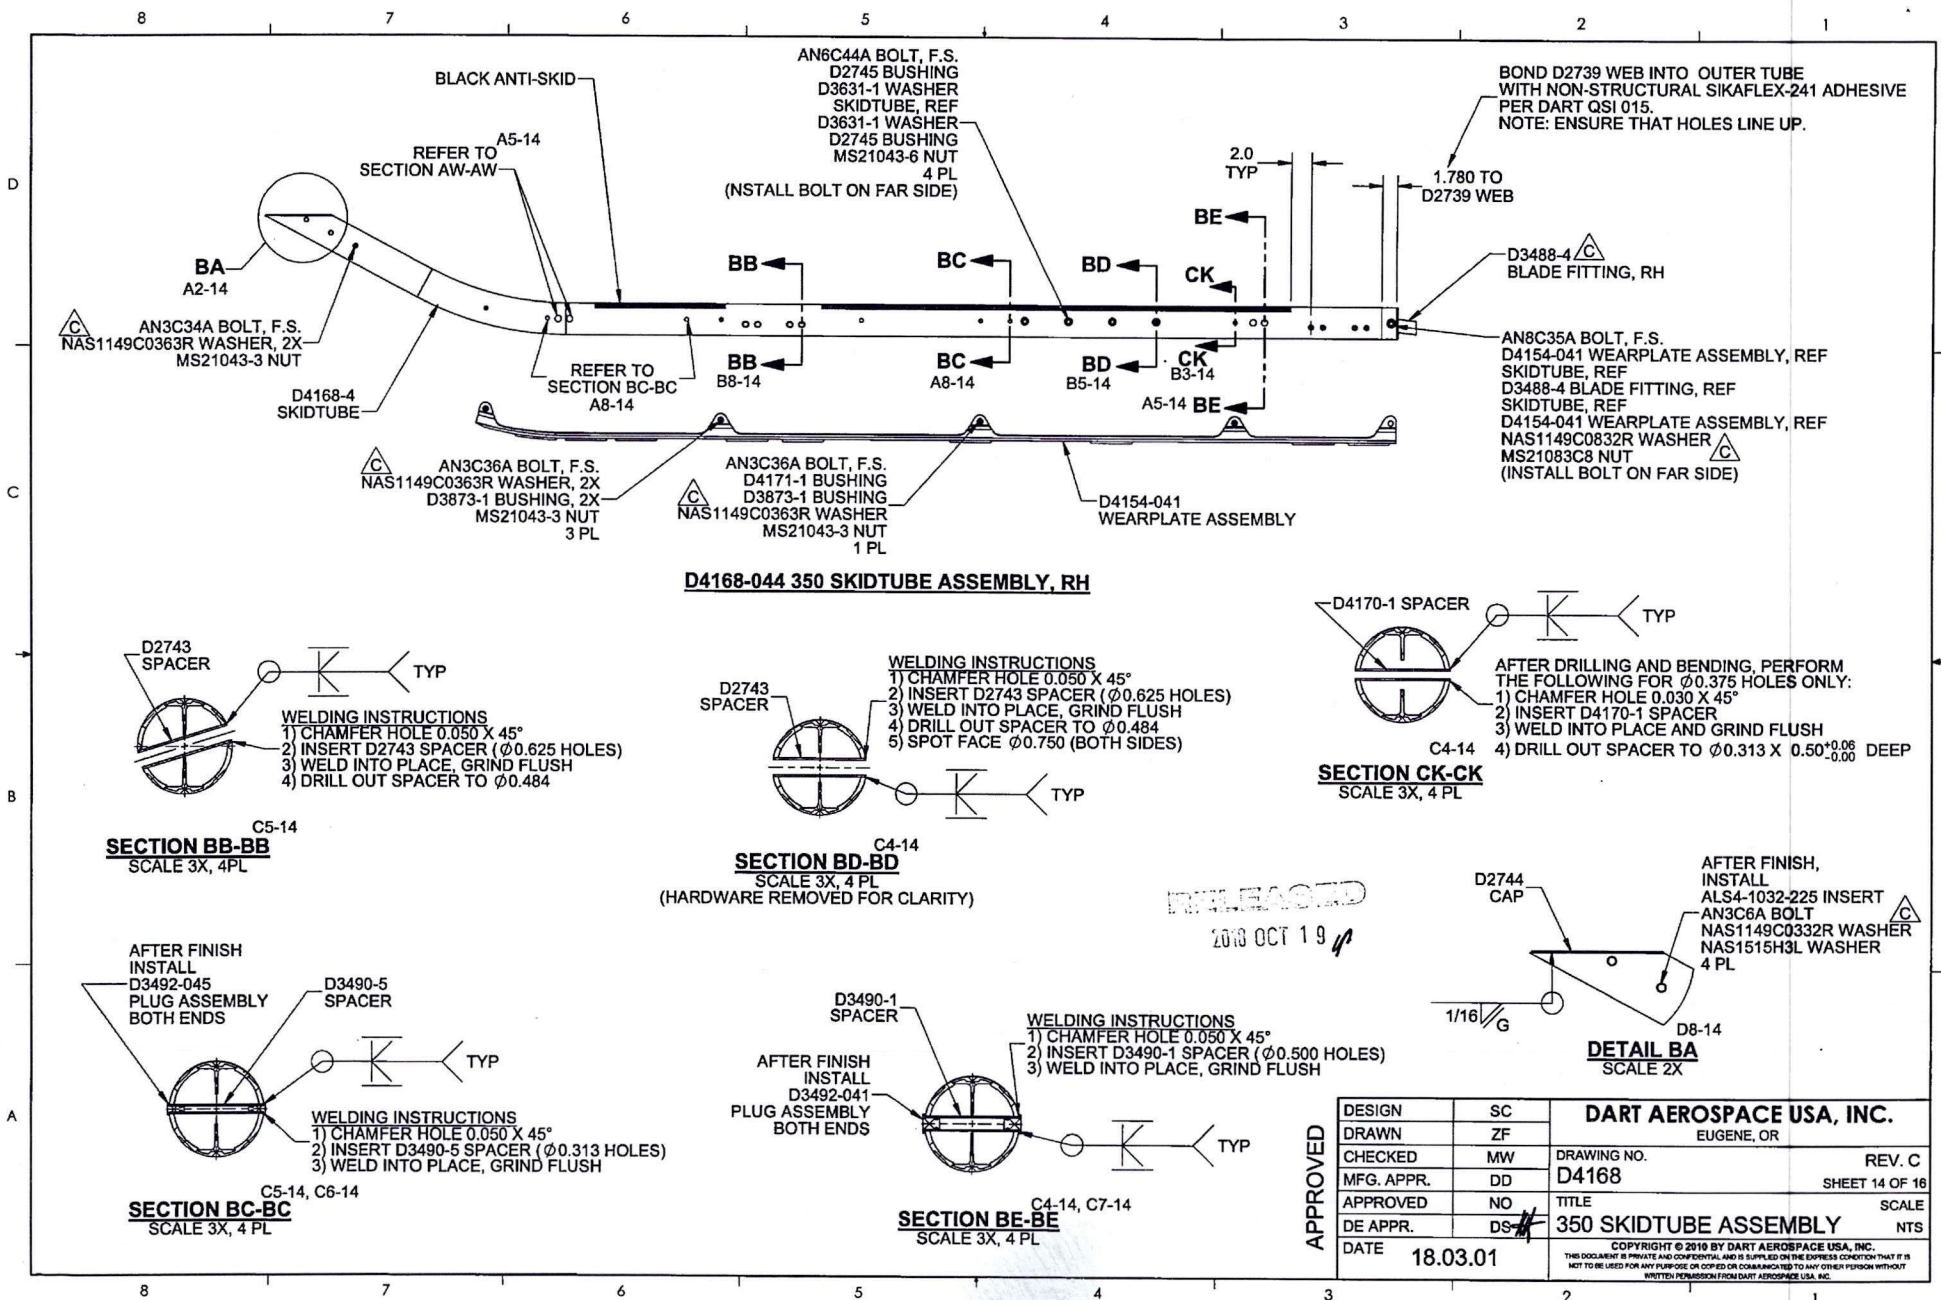

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

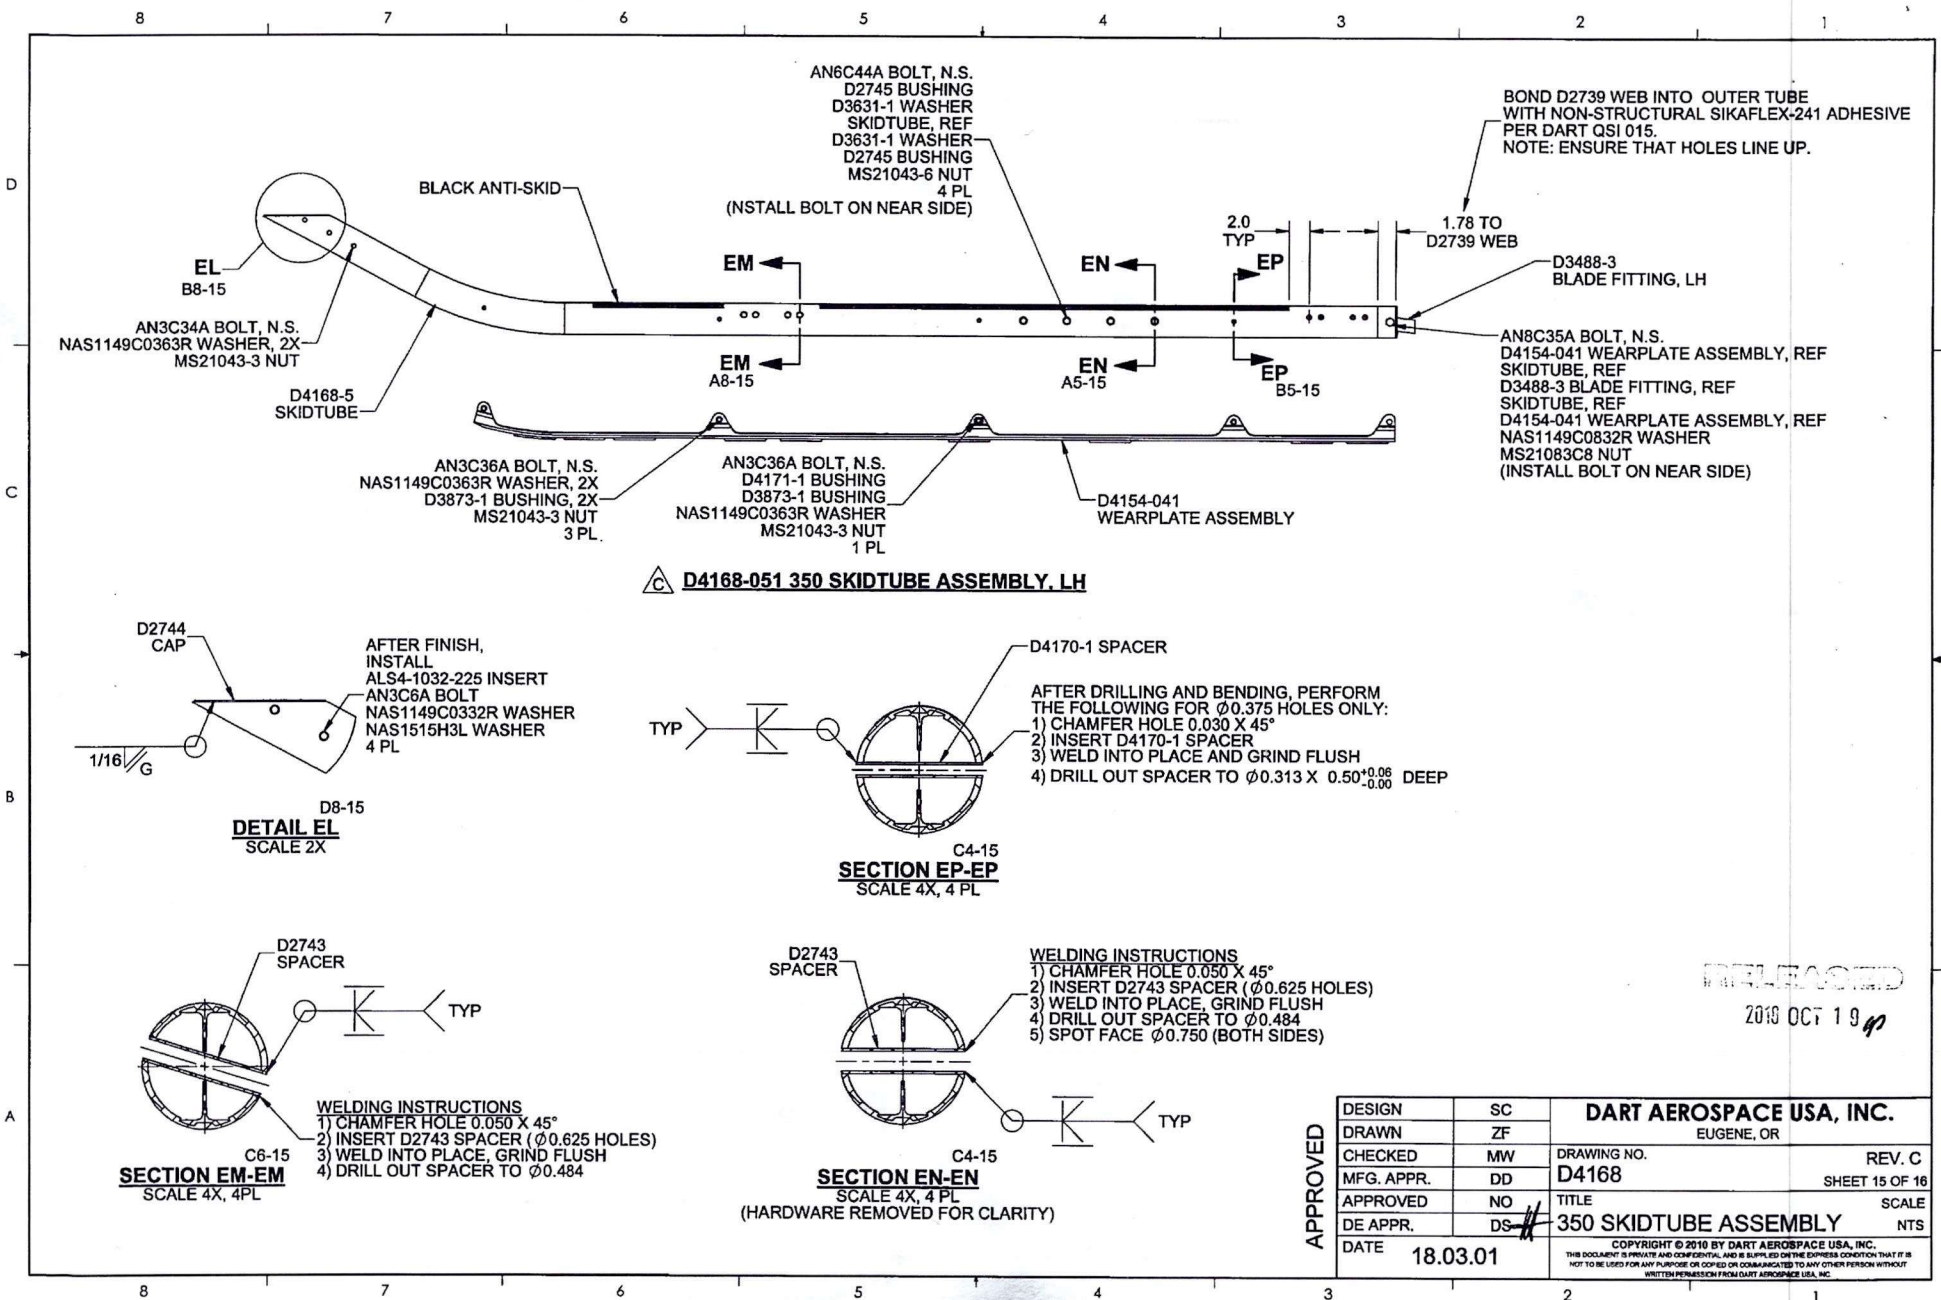

DESIGN	SC	DART AEROSPACE USA, INC.	
DRAWN	ZF	EUGENE, OR	
CHECKED	MW	DRAWING NO.	REV. C
MFG. APPR.	DD	D4168	SHEET 15 OF 16
APPROVED	NO	TITLE	SCALE
DE APPR.	DS	350 SKIDTUBE ASSEMBLY	NTS
DATE	18.03.01	COPYRIGHT © 2010 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

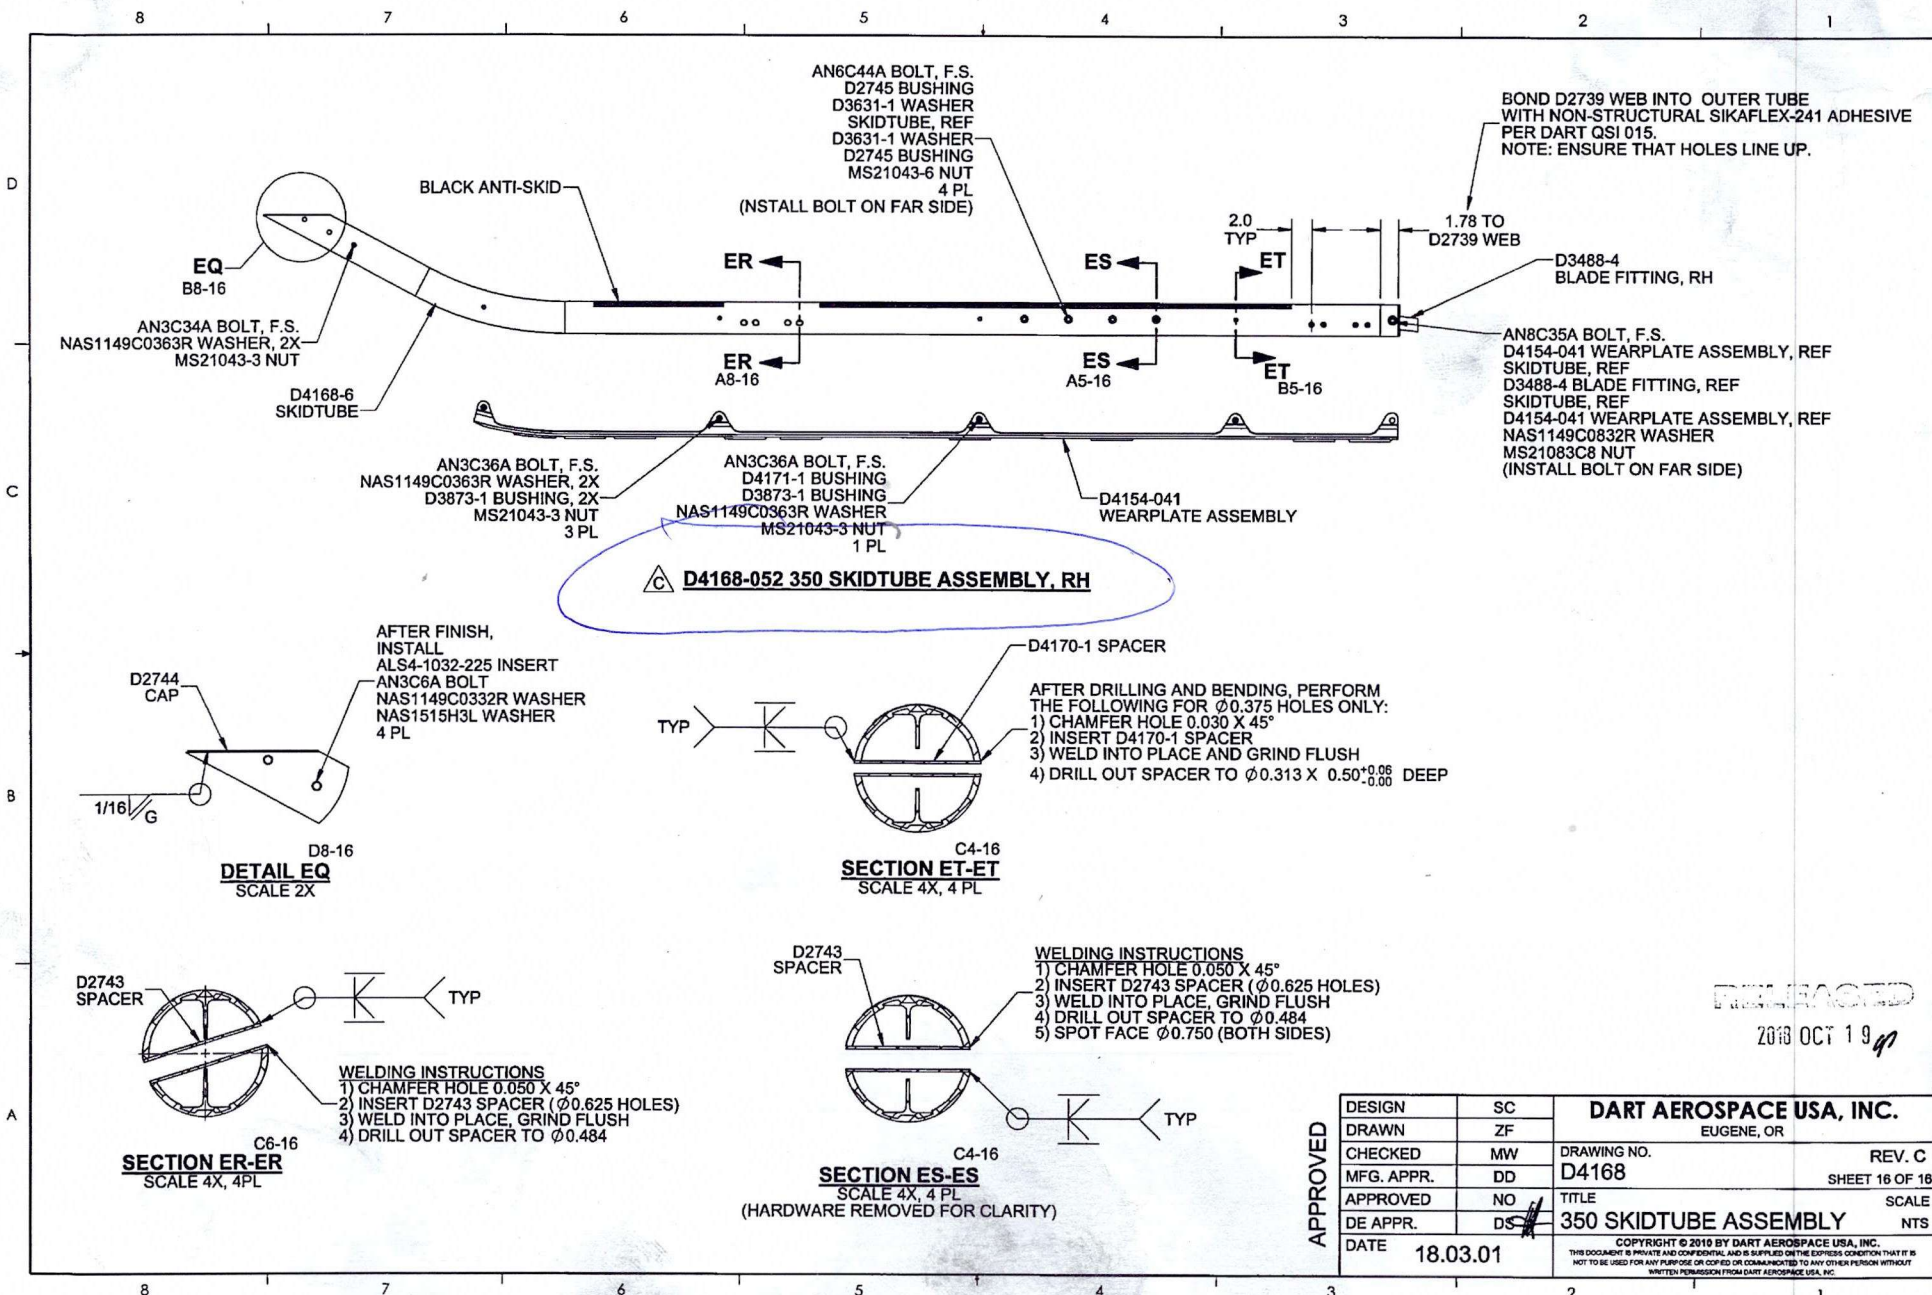

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			

Change Record

PAGE 1 OF 1

Part Number: D350-636-023/-024

Description: SKIDTUBE INSTALLATION LH/RH, STD COMPATIBLE W/TRAINING WEARPLATE

[illegible]